



2018 Speed Dome Base Line Program V2.623.00000000.13 Release Notes

ZHEJIANG DAHUA VISION TECHNOLOGY CO., LTD.

Legal Information

Copyright

© 2018 ZHEJIANG DAHUA VISION TECHNOLOGY CO., LTD. All rights reserved.

This document cannot be copied, transferred, distributed, or saved in any form without the prior written permission of Zhejiang Dahua Vision Technology Co., LTD (hereinafter referred to be "Dahua").

The products described in this document may contain the software that belongs to Dahua or the third party. Without the prior written approval of the corresponding party, any person cannot (including but not limited to) copy, distribute, amend, abstract, reverse compile, decode, reverse engineer, rent, transfer, sublicense the software.

Trademarks

 and **HDCVI** are the trademarks or registered trademarks of Dahua.

All other company names and trademarks mentioned herein are the properties of their respective owners.

Disclaimer

- This release note is for reference only, and the actual product shall prevail.
- Succeeding products and release notes are subject to change without notice.
- If there is any uncertainty or controversy, please refer to our final explanation.

Table of Contents

Legal Information	I
Release Notes	1
1.1 Overview	1
1.2 New Features	1
1.3 Fixed bugs	1
1.4 Compatibility	1
1.5 Software Environment	2
1.6 Pending Issues	3
1.7 Upgrade Guide	3

Release Notes

1.1 Overview

Item	Description
Product model	Eos platform base line program
Version	V2.623.0000000.13.R.181205
Software package information	DH_SD-Eos_MultiLang_NP_Stream3_V2.623.0000000.13.R.181205.zip DH_SD-Eos_MultiLang_PN_Stream3_V2.623.0000000.13.R.181205.zip
OS requirement	None.
Release date	December 5, 2018

1.2 New Features

Adjusted the highest rotating speed of the speed dome.

1.3 Fixed bugs

Fixed bugs	Description
1	Video stops at Point A-PT (0,45) when the tour function is enabled.
2	The message "Please wait for the directory to change" could not be sent after the speed dome name was modified.
3	The input value of custom stream cannot be saved when the frame rate under all encoding types are over 30fps.
4	The preset will be deleted after modifying the preset number and clicking refresh when the preset has already been added to the tour group.
5	Disk error displays "null" in the log.
6	Video detection function in Event Management was not available after testing IVS and after the speed dome is powered off and restarted.
7	The object filter pixel in the IVS and people counting wrongly exceeded 8191×8191.
8	The speed dome stopped working when SD card error occurred or when there was no enough space on the SD card.

1.4 Compatibility

Compatible with the previous version.

1.5 Software Environment

Platform	Model	Version
Client	SmartPss	DH_SmartPSS_ChngEng_Win32_IS_V2.002.0000006.0.T.180728.zip
Tools	NetSDK	General_NetSDK_Chng_Win32_IS_V3.049.0000000.2.R.180127.7z
Tools	PlaySDK	General_PlaySDK_Chng_Windows32_IS_V3.040.0000000.2.R.180704.zip
Tools	ConfigTool	General_ConfigTool_ChngEng_V4.08.0.R.20170727.zip
NVR	NVR5X-I (DH-NVR54 32-I)	DH_NVR5XXX-I_Chng_V3.215.0000010.0.R.20181016.zip
NVR	NVR5X (DH-NVR58 32)	DH_NVR5XXX-4KS2_Chng_V3.216.0000000.0.R.20180530.zip
DSS platform	DSS	DSS Universal Platform: General_DSS70XXS2_Chng_Basic_Mysql_V1.000.0000001.0.R.20181010 DSS pro: General_OverseasDSS-PRO_IS_V7.020.0012000.0.T.20180806.exe
Client	Easy4ip	General_Easy4ip-Android-Phone-Device_Internel_Basic_IS_V2.20.000.R. 17.04.06.apk General_Easy4ip-IOS-Phone-Device_Internel_Basic_IS_V2.20.000.R.170 519.ipa
DMSS	DMSS	General_DMSS-Android-pad-Lite-Device_Internel_Basic_IS_V3.40.003.R. 170804.apk General_DMSS-Android-pad-Plus-Device_Internel_Basic_IS_V3.40.003.R. .170804.apk General_DMSS-Android-Phone-Lite-Device_Internel_Basic_IS_V3.49.003. R.170814.apk General_DMSS-Android-Phone-Plus-Device_Internel_Basic_IS_V3.49.003 .R.170814.apk General_DMSS-IOS-Pad-Lite-Device_Internel_Basic_IS_V3.40.003.R.170 807.ipa General_DMSS-IOS-Pad-Plus-Device_Internel_Basic_IS_V3.40.003.R.17 0807.ipa General_DMSS-IOS-Phone-Lite-Device_Internel_Basic_IS_V3.49.001.R.1 70804.ipa General_DMSS-IOS-Phone-Plus-Device_Internel_Basic_IS_V3.49.001.R. 170804.ipa

1.6 Pending Issues

No.	Issue description	Possible result	How to fix
1	The default main stream is 1792 instead of 6144 after hard resetting the speed dome or restoring the speed dome to the factory setting.	Stream settings after the hard reset will be influenced.	Reset the stream after restoring the speed dome to the factory settings on the Live interface.
2	More than one snapshots with the same time are displayed during the playback when high frame rate is selected and an alarm is triggered to take a snapshot.	More than one snapshot with the same time will be stored in the SD card.	Disable the high frame rate after the snapshot is enabled.
3	Privacy maskings of four presets among the six presets are not at the preset positions during the tour.	Privacy maskings cannot all play their roles if the maskings are drawn at places where the ordinates are negative.	Draw the privacy maskings at places where the ordinates are positive.
4	The system prompts "Operation failed" after configuring the FTP and after clicking the test button.	Slightly serious.	Restore the time setting to the default.
5	The speed dome was made to focus repeatedly under the RS-485 and D1\PELCOP\PELCOD protocol.	The speed dome cannot be controlled when RS-485 and D1\PELCOP\PELCOD protocol are applied.	No solutions yet.

1.7 Update Guide

This platform supports dual backup. Try to keep the power on during update.

ZHEJIANG DAHUA VISION TECHNOLOGY CO., LTD.

Address: No.1199, Bin'an Road, Binjiang District, Hangzhou, P.R. China

Postcode: 310053

Tel: +86-571-87688883

Fax: +86-571-87688815

Email: overseas@dahuatech.com

Website: www.dahuasecurity.com